



**EN**

## Power source

Tetrix 300 DC Smart 2.0 puls TM  
Tetrix 300 AC/DC Smart 2.0 puls TM  
Tetrix 300 DC Comfort 2.0 puls TM  
Tetrix 300 AC/DC Comfort 2.0 puls TM

099-000235-EW501

Observe additional system documents!

17.12.2020

**Register now  
and benefit!  
Jetzt Registrieren  
und Profitieren!**

[www.ewm-group.com](http://www.ewm-group.com)



## General instructions

### WARNING



#### **Read the operating instructions!**

**The operating instructions provide an introduction to the safe use of the products.**

- Read and observe the operating instructions for all system components, especially the safety instructions and warning notices!
- Observe the accident prevention regulations and any regional regulations!
- The operating instructions must be kept at the location where the machine is operated.
- Safety and warning labels on the machine indicate any possible risks. Keep these labels clean and legible at all times.
- The machine has been constructed to state-of-the-art standards in line with any applicable regulations and industrial standards. Only trained personnel may operate, service and repair the machine.
- Technical changes due to further development in machine technology may lead to a differing welding behaviour.

**In the event of queries on installation, commissioning, operation or special conditions at the installation site, or on usage, please contact your sales partner or our customer service department on +49 2680 181-0.**

**A list of authorised sales partners can be found at [www.ewm-group.com/en/specialist-dealers](http://www.ewm-group.com/en/specialist-dealers).**

Liability relating to the operation of this equipment is restricted solely to the function of the equipment. No other form of liability, regardless of type, shall be accepted. This exclusion of liability shall be deemed accepted by the user on commissioning the equipment.

The manufacturer is unable to monitor whether or not these instructions or the conditions and methods are observed during installation, operation, usage and maintenance of the equipment.

An incorrectly performed installation can result in material damage and injure persons as a result. For this reason, we do not accept any responsibility or liability for losses, damages or costs arising from incorrect installation, improper operation or incorrect usage and maintenance or any actions connected to this in any way.

#### © EWM AG

Dr. Günter-Henle-Strasse 8  
56271 Mündersbach Germany  
Tel.: +49 2680 181-0, Fax: -244  
Email: [info@ewm-group.com](mailto:info@ewm-group.com)  
**[www.ewm-group.com](http://www.ewm-group.com)**

The copyright to this document remains the property of the manufacturer.

Copying, including extracts, only permitted with written approval.

The content of this document has been prepared and reviewed with all reasonable care. The information provided is subject to change; errors excepted.

# 1 Contents

<b>1</b>	<b>Contents</b> .....	<b>3</b>
<b>2</b>	<b>For your safety</b> .....	<b>5</b>
2.1	Notes on using these operating instructions.....	5
2.2	Explanation of icons.....	6
2.3	Safety instructions.....	7
2.4	Transport and installation .....	10
<b>3</b>	<b>Intended use</b> .....	<b>12</b>
3.1	Applications.....	12
3.2	Documents which also apply .....	12
3.2.1	Warranty .....	12
3.2.2	Declaration of Conformity.....	12
3.2.3	Welding in environments with increased electrical hazards.....	12
3.2.4	Service documents (spare parts and circuit diagrams).....	12
3.2.5	Calibration/Validation .....	12
3.2.6	Part of the complete documentation.....	13
<b>4</b>	<b>Machine description – quick overview</b> .....	<b>14</b>
4.1	Front view / rear view.....	14
<b>5</b>	<b>Design and function</b> .....	<b>16</b>
5.1	Transport and installation .....	16
5.1.1	Ambient conditions .....	16
5.1.1.1	In operation .....	16
5.1.1.2	Transport and storage.....	16
5.1.2	Machine cooling.....	16
5.1.3	Workpiece lead, general.....	17
5.1.4	Transport belt .....	17
5.1.4.1	Adjusting the length of the carrying strap .....	17
5.1.5	Welding torch cooling system.....	17
5.1.6	Notes on the installation of welding current leads.....	18
5.1.7	Stray welding currents.....	20
5.1.8	Mains connection.....	21
5.1.8.1	Mains configuration .....	21
5.2	TIG welding.....	22
5.2.1	Welding torch and workpiece line connection .....	22
5.2.1.1	Control lead connection .....	23
5.2.2	Shielding gas supply (shielding gas cylinder for welding machine) .....	23
5.2.2.1	Connecting the shielding gas supply .....	23
5.3	MMA welding .....	25
5.3.1	Connecting the electrode holder and workpiece lead .....	25
5.4	Remote control.....	25
5.4.1	RT1 19POL.....	25
5.4.2	RTG1 19POL.....	26
5.4.3	RTP1 19POL .....	26
5.4.4	RTP2 19POL .....	26
5.4.5	RTP3 spotArc 19POL.....	26
5.4.6	RT50 7POL.....	26
5.4.7	RTF1 19POL .....	26
5.4.8	RTAC1 19POL.....	27
5.4.9	RT PWS1 19POL .....	27
5.5	Voltage reducing device .....	27
5.6	PC interface .....	28
5.6.1	Connection .....	28
5.7	Interfaces for automation .....	28
5.7.1	Remote control connection socket, 19-pole .....	29
<b>6</b>	<b>Maintenance, care and disposal</b> .....	<b>30</b>
6.1	General .....	30
6.1.1	Cleaning .....	30
6.1.2	Dirt filter .....	30

---

6.2	Maintenance work, intervals .....	31
6.2.1	Daily maintenance tasks .....	31
6.2.2	Monthly maintenance tasks .....	31
6.2.3	Annual test (inspection and testing during operation) .....	31
6.3	Disposing of equipment.....	32
<b>7</b>	<b>Rectifying faults.....</b>	<b>33</b>
7.1	Checklist for rectifying faults .....	33
7.2	Vent coolant circuit.....	34
<b>8</b>	<b>Technical data.....</b>	<b>35</b>
8.1	Tetrix 300 .....	35
8.2	Tetrix 300 AC/DC .....	36
<b>9</b>	<b>Accessories .....</b>	<b>37</b>
9.1	Welding torch cooling system .....	37
9.1.1	Coolant - type blueCool .....	37
9.1.2	Coolant - type KF .....	37
9.2	Transport system .....	37
9.3	Remote controls and accessories.....	38
9.3.1	7-pole connection .....	38
9.3.2	19-pole connection .....	38
9.4	Options.....	38
9.5	General accessories .....	38
9.6	Computer communication .....	38
<b>10</b>	<b>Appendix .....</b>	<b>39</b>
10.1	Searching for a dealer.....	39

## 2 For your safety

### 2.1 Notes on using these operating instructions

#### **DANGER**

**Working or operating procedures which must be closely observed to prevent imminent serious and even fatal injuries.**

- Safety notes include the "DANGER" keyword in the heading with a general warning symbol.
- The hazard is also highlighted using a symbol on the edge of the page.

#### **WARNING**

**Working or operating procedures which must be closely observed to prevent serious and even fatal injuries.**

- Safety notes include the "WARNING" keyword in the heading with a general warning symbol.
- The hazard is also highlighted using a symbol in the page margin.

#### **CAUTION**

**Working or operating procedures which must be closely observed to prevent possible minor personal injury.**

- The safety information includes the "CAUTION" keyword in its heading with a general warning symbol.
- The risk is explained using a symbol on the edge of the page.



**Technical aspects which the user must observe to avoid material or equipment damage.**

Instructions and lists detailing step-by-step actions for given situations can be recognised via bullet points, e.g.:

- Insert the welding current lead socket into the relevant socket and lock.

## 2.2 Explanation of icons

Symbol	Description	Symbol	Description
	Indicates technical aspects which the user must observe.		Activate and release / Tap / Tip
	Switch off machine		Release
	Switch on machine		Press and hold
			Switch
	Incorrect / Invalid		Turn
	Correct / Valid		Numerical value – adjustable
	Input		Signal light lights up in green
	Navigation		Signal light flashes green
	Output		Signal light lights up in red
	Time representation (e.g.: wait 4 s / actuate)		Signal light flashes red
	Interruption in the menu display (other setting options possible)		
	Tool not required/do not use		
	Tool required/use		

## 2.3 Safety instructions

### **WARNING**



**Risk of accidents due to non-compliance with the safety instructions!**  
**Non-compliance with the safety instructions can be fatal!**

- Carefully read the safety instructions in this manual!
- Observe the accident prevention regulations and any regional regulations!
- Inform persons in the working area that they must comply with the regulations!



**Risk of injury from electrical voltage!**

**Voltages can cause potentially fatal electric shocks and burns on contact. Even low voltages can cause a shock and lead to accidents.**

- Never touch live components such as welding current sockets or stick, tungsten or wire electrodes!
- Always place torches and electrode holders on an insulated surface!
- Wear the full personal protective equipment (depending on the application)!
- The machine may only be opened by qualified personnel!
- The device must not be used to defrost pipes!



**Hazard when interconnecting multiple power sources!**

**If a number of power sources are to be connected in parallel or in series, only a technical specialist may interconnect the sources as per standard IEC 60974-9:2010: Installation and use and German Accident Prevention Regulation BVG D1 (formerly VBG 15) or country-specific regulations.**

**Before commencing arc welding, a test must verify that the equipment cannot exceed the maximum permitted open circuit voltage.**

- Only qualified personnel may connect the machine.
- When taking individual power sources out of operation, all mains and welding current leads must be safely disconnected from the welding system as a whole. (Hazard due to reverse polarity voltage!)
- Do not interconnect welding machines with pole reversing switch (PWS series) or machines for AC welding since a minor error in operation can cause the welding voltages to be combined, which is not permitted.



**Risk of injury due to radiation or heat!**

**Arc radiation can lead to skin and eye injuries.**

**Contact with hot workpieces and sparks can lead to burns.**

- Use hand shield or welding helmet with the appropriate safety level (depends on the application).
- Wear dry protective clothing (e.g. hand shield, gloves, etc.) in accordance with the applicable regulations of your country.
- Persons who are not directly involved should be protected with a welding curtain or suitable safety screen against radiation and the risk of blinding!

## **WARNING**



### **Risk of injury due to improper clothing!**

**During arc welding, radiation, heat and voltage are sources of risk that cannot be avoided. The user has to be equipped with the complete personal protective equipment at all times. The protective equipment has to include:**

- Respiratory protection against hazardous substances and mixtures (fumes and vapours); otherwise implement suitable measures such as extraction facilities.
- Welding helmet with proper protection against ionizing radiation (IR and UV radiation) and heat.
- Dry welding clothing (shoes, gloves and body protection) to protect against warm environments with conditions comparable to ambient temperatures of 100 °C or higher and arcing and work on live components.
- Hearing protection against harming noise.



### **Explosion risk!**

**Apparently harmless substances in closed containers may generate excessive pressure when heated.**

- Move containers with inflammable or explosive liquids away from the working area!
- Never heat explosive liquids, dusts or gases by welding or cutting!



### **Fire hazard!**

**Due to the high temperatures, sparks, glowing parts and hot slag that occur during welding, there is a risk of flames.**

- Be watchful of potential sources of fire in the working area!
- Do not carry any easily inflammable objects, e.g. matches or lighters.
- Ensure suitable fire extinguishers are available in the working area!
- Thoroughly remove any residue of flammable materials from the workpiece prior to starting to weld.
- Only further process workpieces after they have cooled down. Do not allow them to contact any flammable materials!



**⚠ CAUTION****Smoke and gases!**

**Smoke and gases can lead to breathing difficulties and poisoning. In addition, solvent vapour (chlorinated hydrocarbon) may be converted into poisonous phosgene due to the ultraviolet radiation of the arc!**

- Ensure that there is sufficient fresh air!
- Keep solvent vapour away from the arc beam field!
- Wear suitable breathing apparatus if appropriate!

**Noise exposure!**

**Noise exceeding 70 dBA can cause permanent hearing damage!**

- Wear suitable ear protection!
- Persons located within the working area must wear suitable ear protection!



**According to IEC 60974-10, welding machines are divided into two classes of electromagnetic compatibility (the EMC class can be found in the Technical data) > see 8 chapter:**



**Class A** machines are not intended for use in residential areas where the power supply comes from the low-voltage public mains network. When ensuring the electromagnetic compatibility of class A machines, difficulties can arise in these areas due to interference not only in the supply lines but also in the form of radiated interference.



**Class B** machines fulfil the EMC requirements in industrial as well as residential areas, including residential areas connected to the low-voltage public mains network.

**Setting up and operating**

When operating arc welding systems, in some cases, electro-magnetic interference can occur although all of the welding machines comply with the emission limits specified in the standard. The user is responsible for any interference caused by welding.

In order to **evaluate** any possible problems with electromagnetic compatibility in the surrounding area, the user must consider the following: (see also EN 60974-10 Appendix A)

- Mains, control, signal and telecommunication lines
- Radios and televisions
- Computers and other control systems
- Safety equipment
- The health of neighbouring persons, especially if they have a pacemaker or wear a hearing aid
- Calibration and measuring equipment
- The immunity to interference of other equipment in the surrounding area
- The time of day at which the welding work must be carried out

**Recommendations for reducing interference emission**

- Mains connection, e.g. additional mains filter or shielding with a metal tube
- Maintenance of the arc welding system
- Welding leads should be as short as possible and run closely together along the ground
- Potential equalization
- Earthing of the workpiece. In cases where it is not possible to earth the workpiece directly, it should be connected by means of suitable capacitors.
- Shielding from other equipment in the surrounding area or the entire welding system

**Electromagnetic fields!**

**The power source may cause electrical or electromagnetic fields to be produced which could affect the correct functioning of electronic equipment such as IT or CNC devices, telecommunication lines, power cables, signal lines and pacemakers.**



- Observe the maintenance instructions > see 6.2 chapter!
- Unwind welding leads completely!
- Shield devices or equipment sensitive to radiation accordingly!
- The correct functioning of pacemakers may be affected (obtain advice from a doctor if necessary).

## CAUTION



### Obligations of the operator!

**The respective national directives and laws must be complied with when operating the machine!**

- Implementation of national legislation relating to framework directive 89/391/EEC on the introduction of measures to encourage improvements in the safety and health of workers at work and associated individual guidelines.
- In particular, directive 89/655/EEC concerning the minimum safety and health requirements for the use of work equipment by workers at work.
- The regulations applicable to occupational safety and accident prevention in the country concerned.
- Setting up and operating the machine as per IEC 60974.-9.
- Brief the user on safety-conscious work practices on a regular basis.
- Regularly inspect the machine as per IEC 60974.-4.



***The manufacturer's warranty becomes void if non-genuine parts are used!***

- ***Only use system components and options (power sources, welding torches, electrode holders, remote controls, spare parts and replacement parts, etc.) from our range of products!***
- ***Only insert and lock accessory components into the relevant connection socket when the machine is switched off.***

### Requirements for connection to the public mains network

High-performance machines can influence the mains quality by taking current from the mains network. For some types of machines, connection restrictions or requirements relating to the maximum possible line impedance or the necessary minimum supply capacity at the interface with the public network (Point of Common Coupling, PCC) can therefore apply. In this respect, attention is also drawn to the machines' technical data. In this case, it is the responsibility of the operator, where necessary in consultation with the mains network operator, to ensure that the machine can be connected.

## 2.4 Transport and installation

## WARNING



### Risk of injury due to improper handling of shielding gas cylinders!

**Improper handling and insufficient securing of shielding gas cylinders can cause serious injuries!**

- Observe the instructions from the gas manufacturer and any relevant regulations concerning the use of compressed air!
- Do not attach any element to the shielding gas cylinder valve!
- Prevent the shielding gas cylinder from heating up.

**⚠ CAUTION****Risk of accidents due to supply lines!**

During transport, attached supply lines (mains leads, control cables, etc.) can cause risks, e.g. by causing connected machines to tip over and injure persons!

- Disconnect all supply lines before transport!

**Risk of tipping!**

There is a risk of the machine tipping over and injuring persons or being damaged itself during movement and set up. Tilt resistance is guaranteed up to an angle of 10° (according to IEC 60974-1).

- Set up and transport the machine on level, solid ground.
- Secure add-on parts using suitable equipment.

**Risk of accidents due to incorrectly installed leads!**

Incorrectly installed leads (mains, control and welding leads or intermediate hose packages) can present a tripping hazard.

- Lay the supply lines flat on the floor (avoid loops).
- Avoid laying the leads on passage ways.

**Risk of injury from heated coolant and its connections!**

The coolant used and its connection or connection points can heat up significantly during operation (water-cooled version). When opening the coolant circuit, escaping coolant may cause scalding.

- Open the coolant circuit only when the power source or cooling unit is switched off!
- Wear proper protective equipment (protective gloves)!
- Seal open connections of the hose leads with suitable plugs.



***The units are designed for operation in an upright position!***

***Operation in non-permissible positions can cause equipment damage.***

- ***Only transport and operate in an upright position!***



***Accessory components and the power source itself can be damaged by incorrect connection!***

- ***Only insert and lock accessory components into the relevant connection socket when the machine is switched off.***
- ***Comprehensive descriptions can be found in the operating instructions for the relevant accessory components.***
- ***Accessory components are detected automatically after the power source is switched on.***



***Protective dust caps protect the connection sockets and therefore the machine against dirt and damage.***

- ***The protective dust cap must be fitted if there is no accessory component being operated on that connection.***
- ***The cap must be replaced if faulty or if lost!***

## 3 Intended use

### **WARNING**



#### **Hazards due to improper usage!**

The machine has been constructed to the state of the art and any regulations and standards applicable for use in industry and trade. It may only be used for the welding procedures indicated at the rating plate. Hazards may arise for persons, animals and material objects if the equipment is not used correctly. No liability is accepted for any damages arising from improper usage!

- The equipment must only be used in line with its designated purpose and by trained or expert personnel!
- Do not improperly modify or convert the equipment!

### 3.1 Applications

Arc welding machine for TIG DC and AC welding with lift arc (touch starting) or HF ignition (contactless) and MMA welding as secondary process. It may be possible to expand the functionality by using accessories (see the documentation in the relevant chapter).

### 3.2 Documents which also apply

#### 3.2.1 Warranty

For more information refer to the "Warranty registration" brochure supplied and our information regarding warranty, maintenance and testing at [www.ewm-group.com](http://www.ewm-group.com)!

#### 3.2.2 Declaration of Conformity



This product corresponds in its design and construction to the EU directives listed in the declaration. The product comes with a relevant declaration of conformity in the original.

The manufacturer recommends carrying out the safety inspection according to national and international standards and guidelines every 12 months.

#### 3.2.3 Welding in environments with increased electrical hazards



Power sources with this marking can be used for welding in an environment with increased electrical hazard (e.g. boilers). For this purpose, appropriate national or international regulations must be followed. The power source must not be placed in the danger zone!

#### 3.2.4 Service documents (spare parts and circuit diagrams)

### **WARNING**



**Do not carry out any unauthorised repairs or modifications!**

**To avoid injury and equipment damage, the unit must only be repaired or modified by specialist, skilled persons!**

**The warranty becomes null and void in the event of unauthorised interference.**

- Appoint only skilled persons for repair work (trained service personnel)!

Original copies of the circuit diagrams are enclosed with the unit.

Spare parts can be obtained from the relevant authorised dealer.

#### 3.2.5 Calibration/Validation

An original certificate is enclosed with the product. The manufacturer recommends calibration / validation at intervals of 12 months.

### 3.2.6 Part of the complete documentation

This document is part of the complete documentation and valid only in combination with all other parts of these instructions! Read and observe the operating instructions for all system components, especially the safety instructions!

The illustration shows a general example of a welding system.

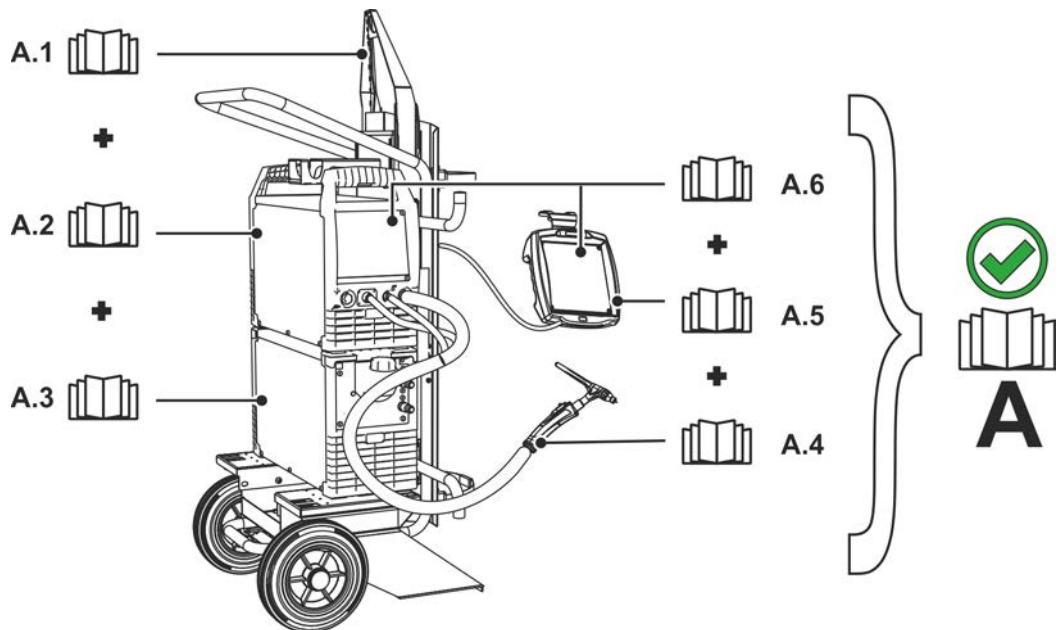


Figure 3-1

Item	Documentation
A.1	Transport vehicle
A.2	Power source
A.3	Cooling unit
A.4	Welding torch
A.5	Remote control
A.6	Control
A	Complete documentation

## 4 Machine description – quick overview

### 4.1 Front view / rear view

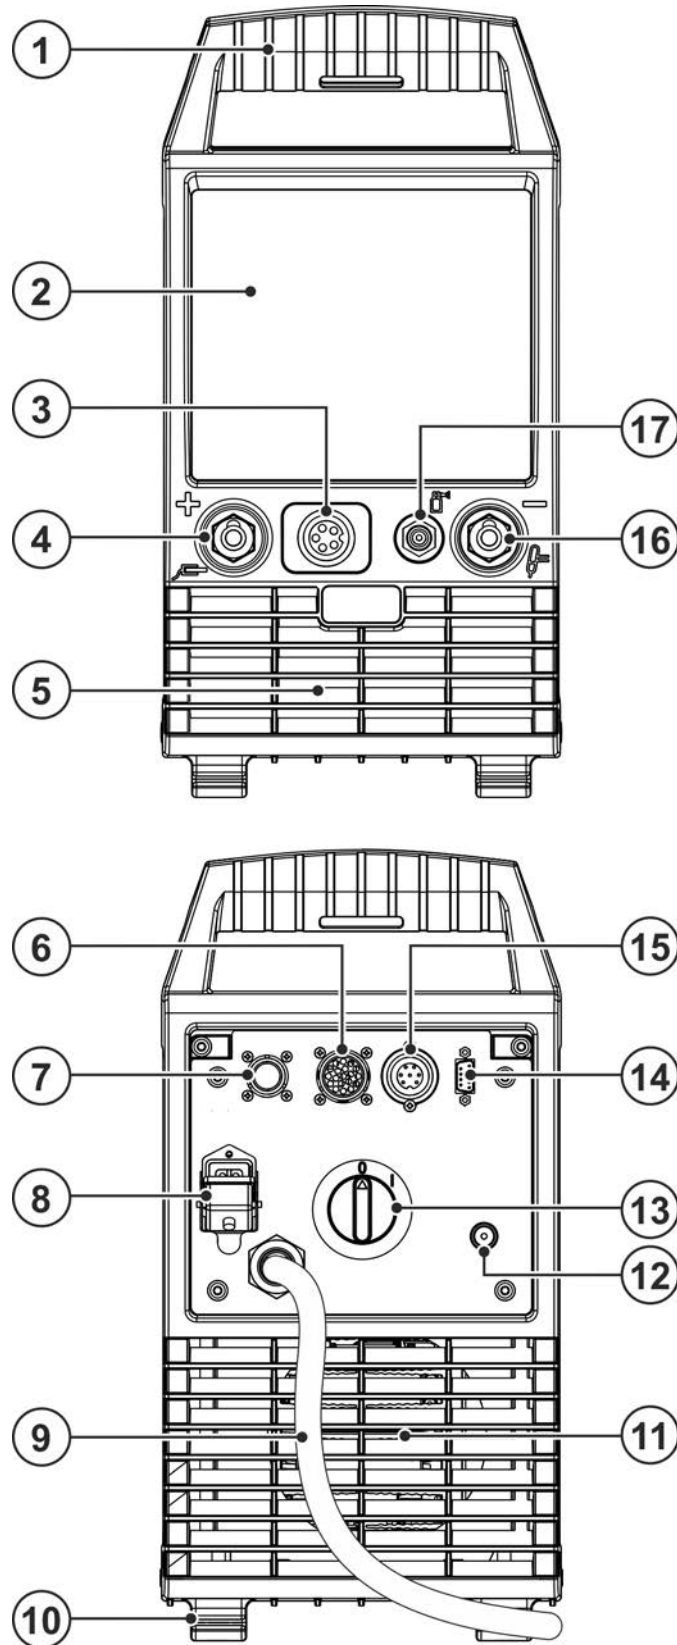












Figure 4-1

Item	Symbol	Description
1		<b>Transport elements</b> Transport handle and transport belt > see 5.1.4 chapter
2		<b>Machine control (see the relevant control operating instructions)</b>
3		<b>Connection socket (welding torch control cable) &gt; see 5.2.1.1 chapter</b>
4		<b>Connection socket, “+” welding current</b> How to connect the accessories depends on the welding procedure. Please observe the connection description for the corresponding welding procedure > see 5 chapter.
5		<b>Cooling air inlet</b>
6		<b>Connection socket, 19-pole</b> Remote control connection
7		<b>8-pole connection socket</b> Cooling unit control lead
8		<b>4-pole connection socket</b> Cooling unit voltage supply
9		<b>Mains connection cable &gt; see 5.1.8 chapter</b>
10		<b>Machine feet</b>
11		<b>Cooling air outlet</b>
12		<b>Connection thread - G<math>\frac{1}{4}</math>"</b> Shielding gas connection (outlet)
13		<b>Main Switch</b> Switching the machine on or off.
14		<b>Connection socket (9-pole) - D-Sub</b> PC interface > see 5.6 chapter
15		<b>7-pole connection socket (digital)</b> For connecting digital accessory components
16		<b>Connection socket, “-” welding current</b> How to connect the accessories depends on the welding procedure. Please observe the connection description for the corresponding welding procedure > see 5 chapter.
17		<b>Connection thread - G<math>\frac{1}{4}</math>"</b> Shielding gas connection (inlet)

## 5 Design and function

### WARNING



**Risk of injury from electrical voltage!**

**Contact with live parts, e.g. power connections, can be fatal!**

- Observe the safety information on the first pages of the operating instructions!
- Commissioning must be carried out by persons who are specifically trained in handling power sources!
- Connect connection or power cables while the machine is switched off!

Read and observe the documentation to all system and accessory components!

### 5.1 Transport and installation

### WARNING



**Risk of accident due to improper transport of machines that must not be lifted!**

**Do not lift or suspend the machine! The machine can drop and cause injuries! The handles, straps or brackets are suitable for transport by hand only!**

- The machine must not be suspended or lifted using a crane.

#### 5.1.1 Ambient conditions



**The machine must not be operated in the open air and must only be set up and operated on a suitable, stable and level base!**

- The operator must ensure that the ground is non-slip and level, and provide sufficient lighting for the place of work.
- Safe operation of the machine must be guaranteed at all times.



**Equipment damage due to contamination!**

**Unusually high amounts of dust, acids, corrosive gases or substances can damage the machine (observe maintenance intervals > see 6.2 chapter).**

- Avoid large amounts of smoke, steam, oily fumes, grinding dust and corrosive ambient air!

##### 5.1.1.1 In operation

**Temperature range of the ambient air:**

- -25 °C to +40 °C (-13 °F to 104 °F) <sup>[1]</sup>

**Relative humidity:**

- up to 50 % at 40 °C (104 °F)
- up to 90 % at 20 °C (68 °F)

##### 5.1.1.2 Transport and storage

**Storage in a closed room, temperature range of the ambient air:**

- -30 °C to +70 °C (-22 °F to 158 °F) <sup>[1]</sup>

**Relative humidity**

- up to 90 % at 20 °C (68 °F)

<sup>[1]</sup> Ambient temperature dependent on coolant! Observe the coolant temperature range of the torch cooling

#### 5.1.2 Machine cooling



**Insufficient ventilation results in a reduction in performance and equipment damage.**

- Observe the ambient conditions!
- Keep the cooling air inlet and outlet clear!
- Observe the minimum distance of 0.5 m from obstacles!



## 5.1.3 Workpiece lead, general

### ⚠ CAUTION



**Risk of burning due to incorrect welding current connection!**

If the welding current plugs (machine connections) are not locked or if the workpiece connection is contaminated (paint, corrosion), these connections and leads can heat up and cause burns when touched!

- Check welding current connections on a daily basis and lock by turning to the right when necessary.
- Clean workpiece connection thoroughly and secure properly. Do not use structural parts of the workpiece as welding current return lead!

## 5.1.4 Transport belt

### 5.1.4.1 Adjusting the length of the carrying strap

To demonstrate adjustment, lengthening the strap is shown in the figure. To shorten, the strap's loops must be inched in the opposite direction.

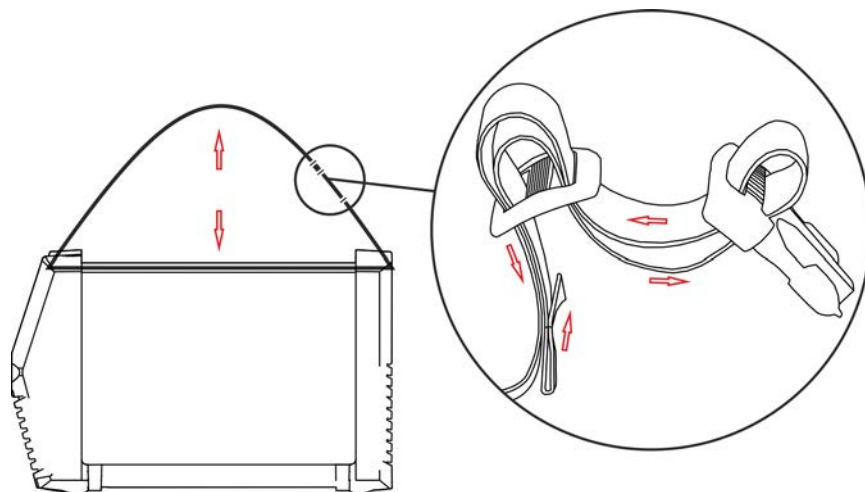


Figure 5-1

## 5.1.5 Welding torch cooling system

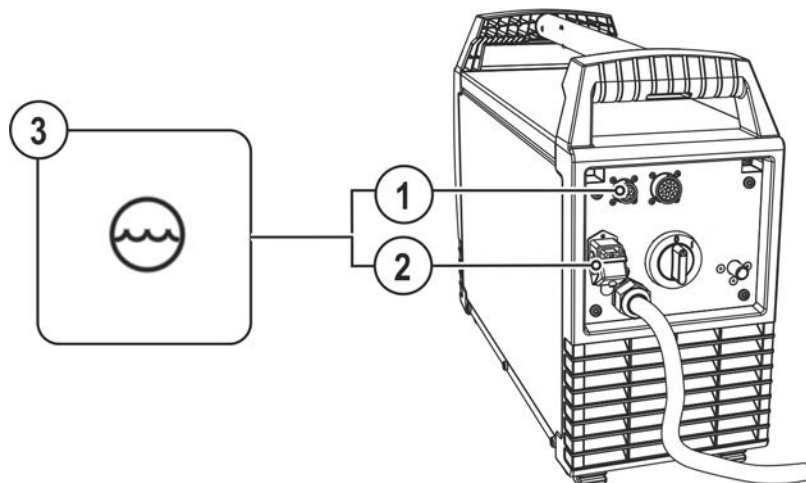


Figure 5-2

Item	Symbol	Description
1		<b>8-pole connection socket</b> Cooling unit control lead
2		<b>4-pole connection socket</b> Cooling unit voltage supply

Item	Symbol	Description
3		Cooling module

- Insert and lock the 8-pole control lead plug on the cooling unit into the 8-pole connection socket on the welding machine.
- Insert and lock the 4-pole supply plug on the cooling unit into the 4-pole connection socket on the welding machine.

## 5.1.6 Notes on the installation of welding current leads

- Incorrectly installed welding current leads can cause faults in the arc (flickering).
- Lay the workpiece lead and hose package of power sources without HF igniter (MIG/MAG) for as long and as close as possible in parallel.
- Lay the workpiece lead and hose package of power sources with HF igniter (TIG) for as long as possible in parallel with a distance of 20 cm to avoid HF sparkover.
- Always keep a distance of at least 20 cm to leads of other power sources to avoid interferences
- Always keep leads as short as possible! For optimum welding results max. 30 m (welding lead + intermediate hose package + torch lead).

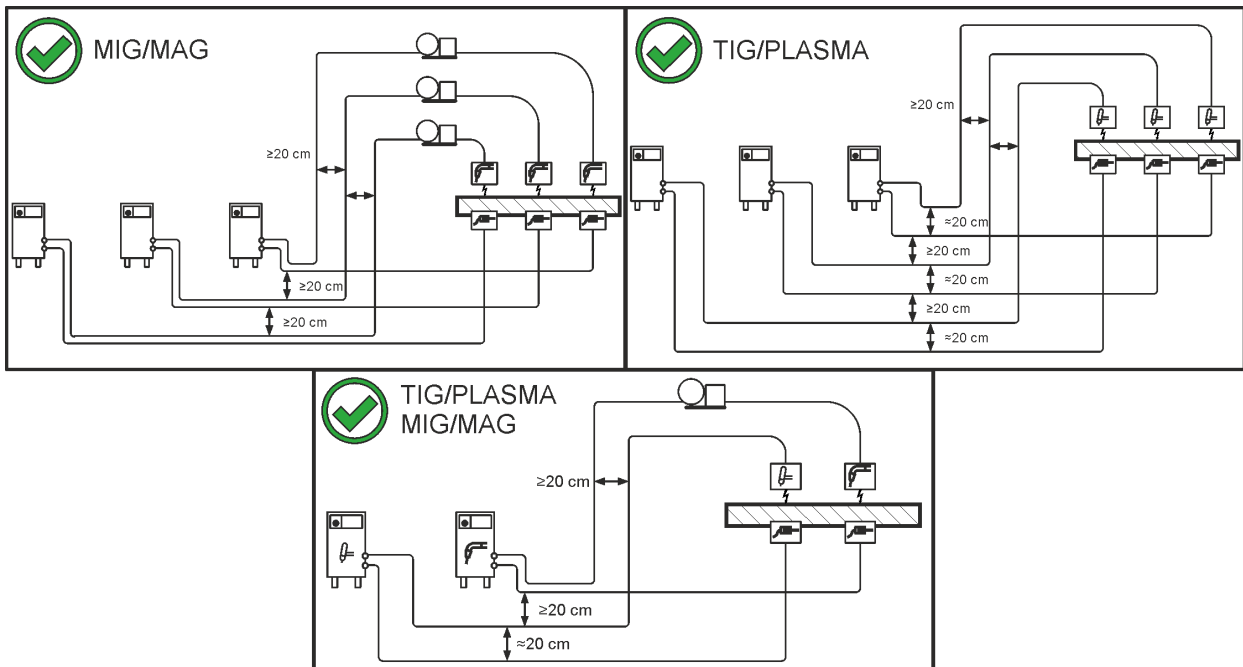


Figure 5-3

- Use an individual welding lead to the workpiece for each welding machine!

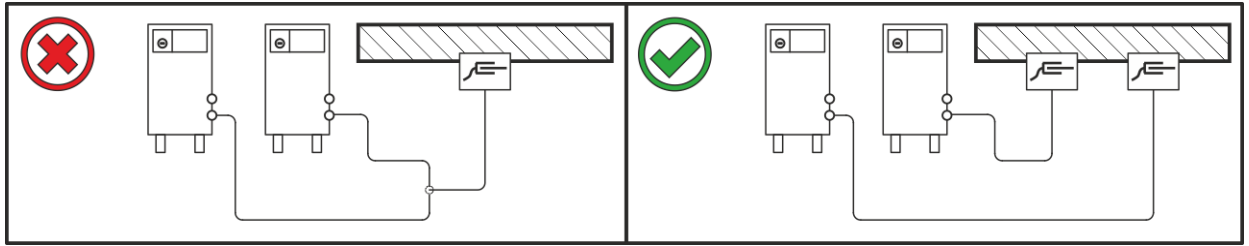


Figure 5-4

- Fully unroll welding current leads, torch hose packages and intermediate hose packages. Avoid loops!
- Always keep leads as short as possible!

**Lay any excess cable lengths in meanders.**

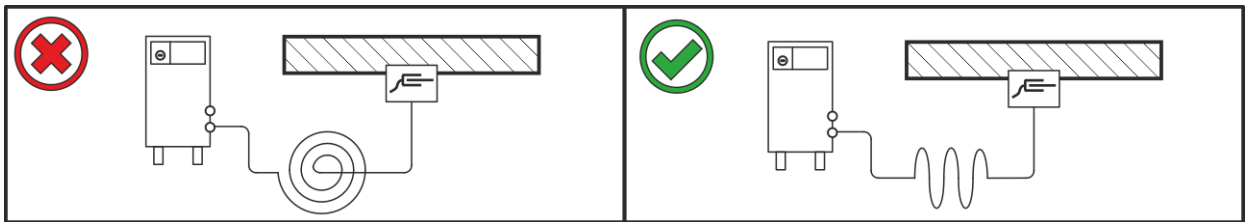


Figure 5-5

## 5.1.7 Stray welding currents

### ⚠ WARNING



**Risk of injury due to stray welding currents!**

**Stray welding currents can destroy protective earth conductors, damage machines and electronic devices and cause overheating of components, leading to fire.**

- Check that all welding current connections are firmly secured and electrical connections are in perfect condition.
- Set up, attach or suspend all conductive power source components such as casing, transport vehicles and crane frames so they are insulated.
- Do not place any other electronic devices such as drills or angle grinders on the power source, transport vehicle or crane frames unless they are insulated.
- Always put welding torches and electrode holders on an insulated surface when they are not in use.

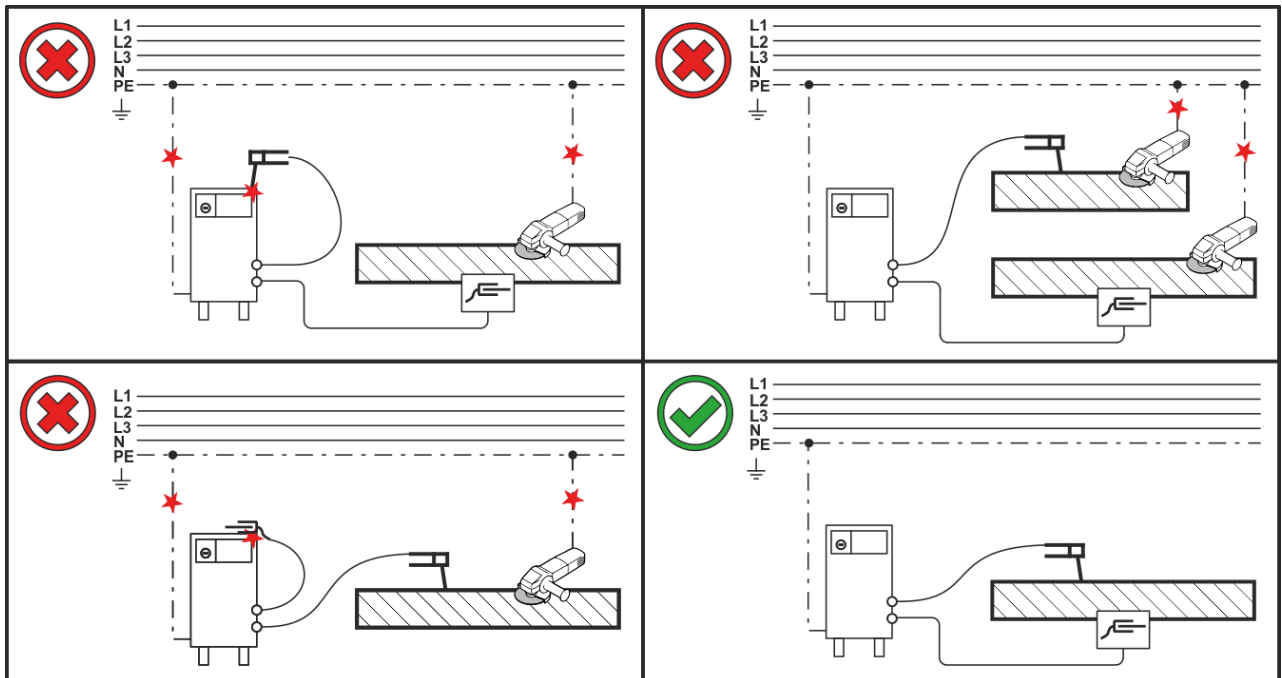


Figure 5-6

## 5.1.8 Mains connection

### DANGER



#### Hazards caused by improper mains connection!

#### An improper mains connection can cause injuries or damage property!

- The connection (mains plug or cable), the repair or voltage adjustment of the device must be carried out by a qualified electrician in accordance with the respective local laws or national regulations!
- The mains voltage indicated on the rating plate must match the supply voltage.
- Only operate machine using a socket that has correctly fitted protective earth.
- Mains plug, socket and lead must be checked by a qualified electrician on a regular basis!
- When operating the generator, always ensure it is earthed as stipulated in the operating instructions. The network created must be suitable for operating machines according to protection class I.

### 5.1.8.1 Mains configuration

The machine may be connected to:

- a three-phase system with four conductors and an earthed neutral conductor
- a three-phase system with three conductors of which any one can be earthed, e.g. the outer conductor

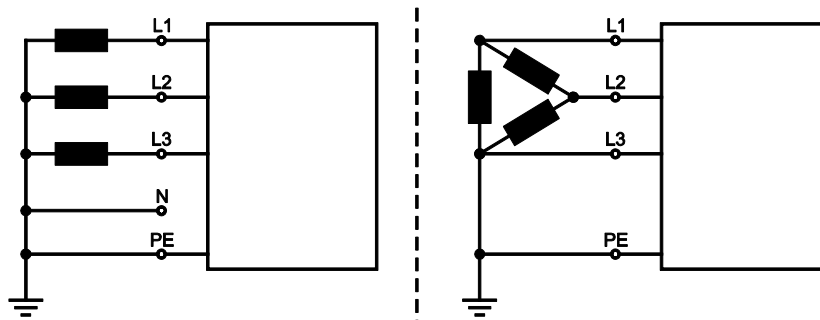


Figure 5-7

#### Legend

Item	Designation	Colour code
L1	Outer conductor 1	brown
L2	Outer conductor 2	black
L3	Outer conductor 3	grey
N	Neutral conductor	blue
PE	Protective conductor	green-yellow

- Insert mains plug of the switched-off machine into the appropriate socket.

## 5.2 TIG welding

### 5.2.1 Welding torch and workpiece line connection

Prepare welding torch according to the welding task in hand (see operating instructions for the torch).

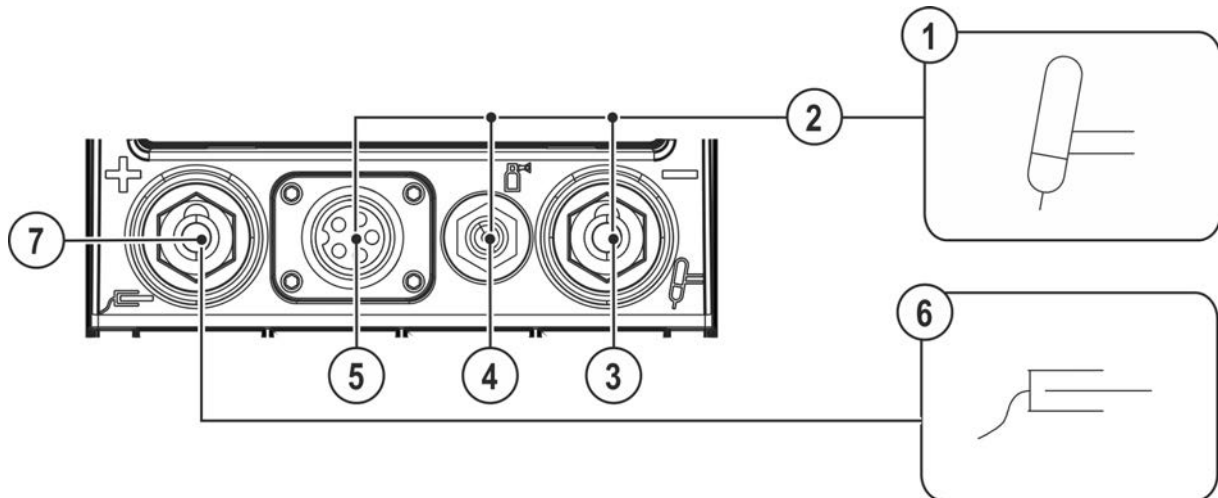


Figure 5-8

Item	Symbol	Description
1		<b>Welding torch</b>
2		<b>Welding torch hose package</b>
3		<b>Connection socket, "-" welding current</b> Welding current lead connection for TIG welding torch
4		<b>Connection thread - G<math>\frac{1}{4}</math>"</b> Shielding gas connection (outlet)
5		<b>Connection socket (welding torch control cable)</b>
6		<b>Workpiece</b>
7		<b>Connection socket for "+" welding current</b> Workpiece lead connection

- Insert the welding current plug on the welding torch into the welding current connection socket and lock by turning to the right.
- Remove yellow protective cap on G $\frac{1}{4}$ " connecting nipple.
- Screw welding torch shielding gas connection tightly onto the G $\frac{1}{4}$ " connection nipple.
- Plug the welding torch control cable plug into the welding torch control cable connection socket and secure.
- Insert the cable plug on the work piece lead into the "+" welding current connection socket and lock by turning to the right.

If fitted:

- Lock connecting nipples of the cooling water tubes into the corresponding quick connect couplings:  
Return line red to quick connect coupling, red (coolant return) and supply line blue to quick connect coupling, blue (coolant supply).

**Read and observe the documentation to all system and accessory components!**

## 5.2.1.1 Control lead connection

TIG welding machines are equipped ex works with a dedicated connection socket for the welding torch control cable (5- or 8-pole). As mobile machines offer more free space, they may even feature two control cable connection sockets. The functionality increases with the number of poles. One of these connection sockets may be converted or retrofitted > see 9.4 chapter.

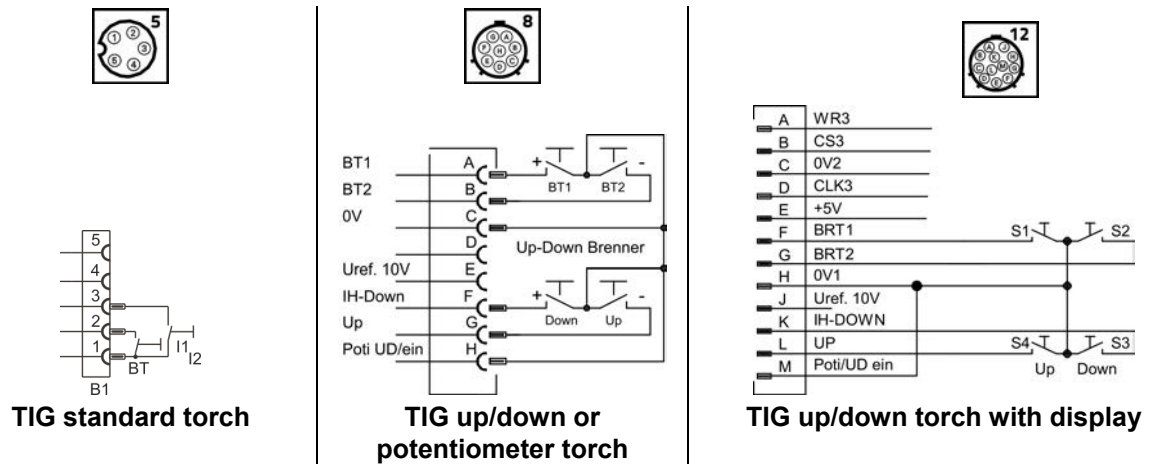


Figure 5-9

## 5.2.2 Shielding gas supply (shielding gas cylinder for welding machine)

### ⚠ WARNING



**Risk of injury due to improper handling of shielding gas cylinders!**  
**Improper handling and insufficient securing of shielding gas cylinders can cause serious injuries!**

- Observe the instructions from the gas manufacturer and any relevant regulations concerning the use of compressed air!
- Do not attach any element to the shielding gas cylinder valve!
- Prevent the shielding gas cylinder from heating up.



**An unhindered shielding gas supply from the shielding gas cylinder to the welding torch is a fundamental requirement for optimum welding results. In addition, a blocked shielding gas supply may result in the welding torch being destroyed.**

- **Always re-fit the yellow protective cap when not using the shielding gas connection.**
- **All shielding gas connections must be gas tight.**

### 5.2.2.1 Connecting the shielding gas supply

- Place the shielding gas cylinder into the relevant cylinder bracket.
- Secure the shielding gas cylinder using a securing chain.

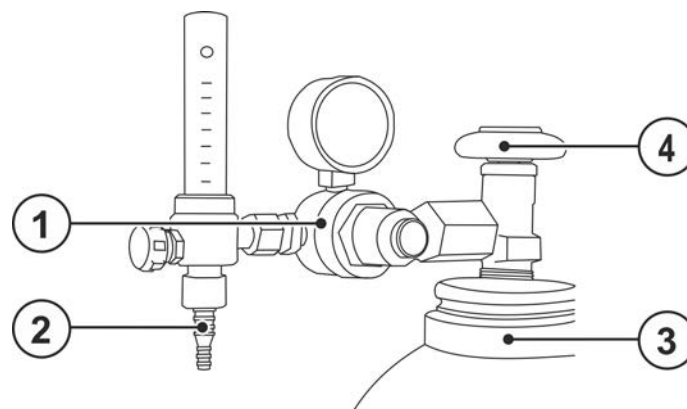


Figure 5-10

Item	Symbol	Description
1		Pressure regulator

Item	Symbol	Description
2		Shielding gas cylinder
3		Output side of the pressure regulator
4		Cylinder valve

- Before connecting the pressure regulator to the gas cylinder, open the cylinder valve briefly to blow out any dirt.
- Tighten the pressure regulator screw connection on the gas bottle valve to be gas-tight.
- Screw the gas hose connection to the outlet side of the pressure regulator gas-tight.


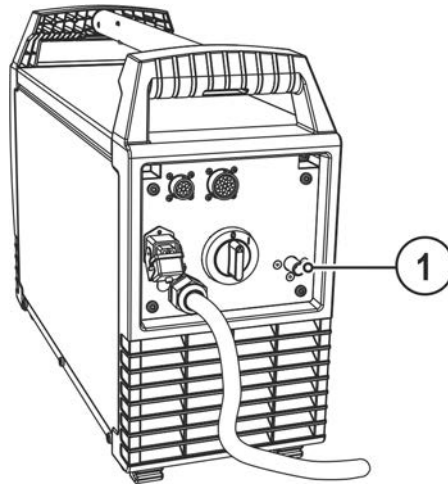


Figure 5-11

Item	Symbol	Description
1		Connection thread - G $\frac{1}{4}$ " Shielding gas connection (inlet)

 - Screw the gas hose connection to the shielding gas connection (inlet) on the machine gas-tight.



## 5.3 MMA welding

### 5.3.1 Connecting the electrode holder and workpiece lead

#### ⚠ CAUTION



#### Risk of crushing and burns!

When changing stick electrodes there is a risk of crushing and burns!

- Wear appropriate and dry protective gloves.
- Use an insulated pair of tongs to remove the used stick electrode or to move welded workpieces.



#### Electrical voltage at the shielding gas connection!

During MMA welding open circuit voltage is applied at the shielding gas connection (G $\frac{1}{4}$ " connecting nipple).

- Place yellow insulating cap on the G $\frac{1}{4}$ " connection nipple (protects against electrical voltage and dirt).

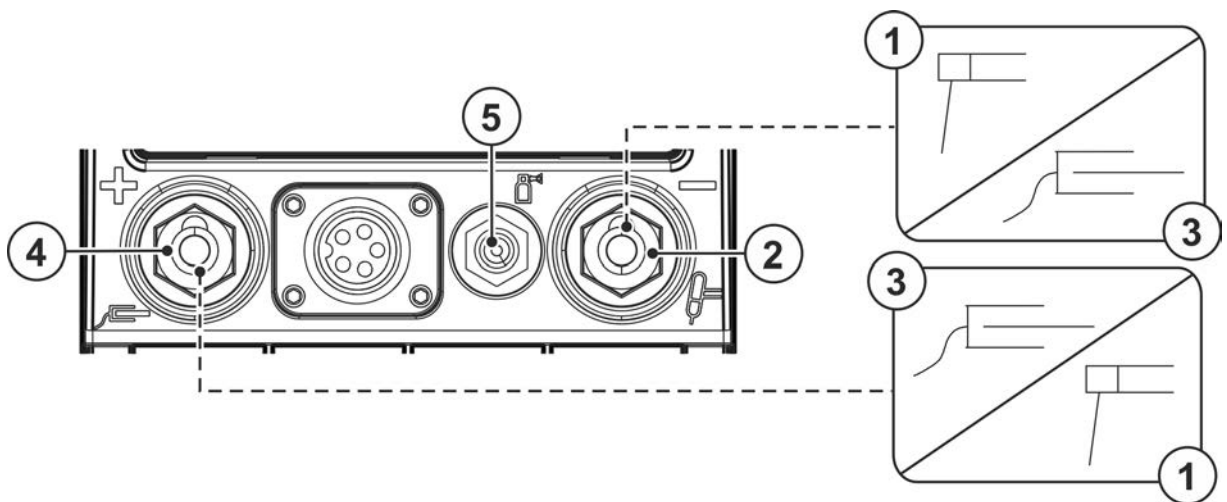


Figure 5-12

Item	Symbol	Description
1		Electrode holder
2		Connection socket, "-" welding current Workpiece lead or electrode holder connection
3		Workpiece
4		Connection socket for "+" welding current Electrode holder or workpiece lead connection
5		Connection thread - G $\frac{1}{4}$ " Shielding gas connection (inlet)

- Insert the electrode holder plug and workpiece lead into the welding current socket depending on application and lock in place by turning to the right. The corresponding polarity will be based on the information of the electrode manufacturer on the electrode packaging.
- Fit yellow protective cap onto G $\frac{1}{4}$ " connecting nipple.

## 5.4 Remote control

The remote controls are operated on the 19-pole remote control connection socket (analogue).

### 5.4.1 RT1 19POL



#### Functions

- Infinitely adjustable welding current (0% to 100%) depending on the preselected main current on the welding machine.


## 5.4.2 RTG1 19POL



### Functions

- Infinite setting of the welding current (0% to 100%) depending on the main current preselected at the welding machine


## 5.4.3 RTP1 19POL

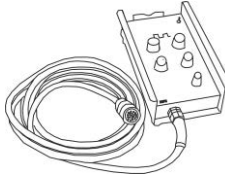

### Functions

- TIG/MMA
- Infinitely adjustable welding current (0% to 100%) depending on the preselected main current on the welding machine.
- Pulse/spot/normal
- Pulse, spot and break times are infinitely adjustable.


## 5.4.4 RTP2 19POL

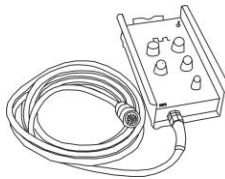

### Functions

- TIG/MMA.
- Infinitely adjustable welding current (0% to 100%) depending on the preselected main current on the welding machine.
- Pulse/spot/normal
- Frequency and spot times infinitely adjustable.
- Coarse adjustment of the cycle frequency.
- Pulse/pause ratio (balance) adjustable from 10% to 90%.


## 5.4.5 RTP3 spotArc 19POL

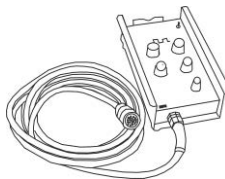

### Functions

- TIG / MMA.
- Infinitely adjustable welding current (0% to 100%) depending on the preselected main current on the welding machine.
- Pulse / SpotArc spots / normal
- Frequency and spot time infinitely adjustable.
- Coarse adjustment of the pulse frequency.
- Pulse/pause ratio (balance) adjustable from 10% to 90%.

 
## 5.4.6 RT50 7POL



### Functions

- Remote control for all welding machine and accessory functions.

## 5.4.7 RTF1 19POL

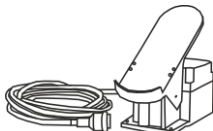

### Functions

- Infinitely adjustable welding current (0% to 100%) depending on the preselected main current on the welding machine.
- Start/stop welding operation (TIG)

ActivArc welding is not possible in combination with the foot-operated remote control.


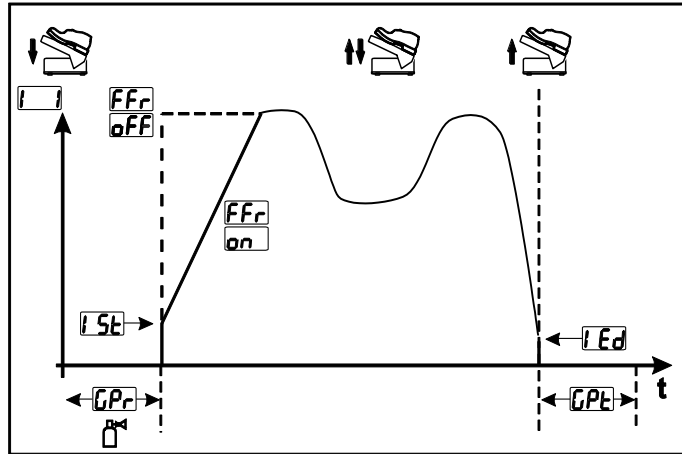


Figure 5-13

Symbol	Meaning
	Actuate foot-operated remote control (start welding process)
	Operate foot-operated remote control (set welding current according to application)
	Release foot-operated remote control (end welding process)

### 5.4.8 RTAC1 19POL

Suitable for machines with AC welding type only.

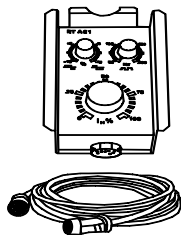


#### Functions

- Infinitely adjustable welding current (0% to 100%) depending on the preselected main current on the welding machine.
- AC frequency of welding current infinitely adjustable.
- AC balance (positive/negative half-wave ratio) can be set from +15% to -15%.

### 5.4.9 RT PWS1 19POL

 Suitable for machines with AC welding type only.



#### Functions

- Infinitely adjustable welding current (0% to 100%) depending on the preselected main current at the welding machine
- Pole reversing switch, suitable for machines with PWS function

## 5.5 Voltage reducing device

Only machine variants with the (VRD/SVRD/AUS/RU) code are equipped with a voltage reduction device (VRD). The VRD is used for increased safety, especially in hazardous environments such as shipbuilding, pipe construction or mining.

A VRD is mandatory in some countries and required by many on-site safety instructions for power sources.

The VRD signal light is illuminated when the voltage reduction device is operating without fault and the output voltage is reduced to a value specified in the relevant standard (see technical data).

## 5.6 PC interface



**Equipment damage or faults may occur if the PC is connected incorrectly!**

**Not using the SECINT X10USB interface results in equipment damage or faults in signal transmission. The PC may be destroyed due to high frequency ignition pulses.**

- **Interface SECINT X10USB must be connected between the PC and the welding machine!**
- **The connection must only be made using the cables supplied (do not use any additional extension cables)!**

### PC300.Net welding parameter software

Set all welding parameters on the PC and simply transfer to one or more welding machines (accessory, set consisting of software, interface, connection leads)

- Manage up to 510 JOBS
- Exchange JOBS with the welding machine
- Online data communication
- Default settings for welding data monitoring
- Always up-to-date thanks to standard update function for new welding parameters
- Data backup by easy communication between power source and PC

### 5.6.1 Connection

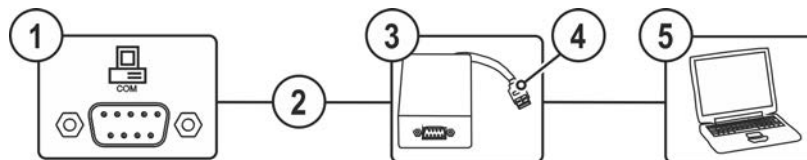


Figure 5-14

Item	Symbol	Description
1		<b>Connection socket (9-pole) - D-Sub</b> PC interface
2		<b>Connection cable, 9-pole, serial</b>
3		<b>SECINT X10 USB</b>
4		<b>USB connection</b> Connecting a Windows PC to SECINT X10 USB
5		<b>Windows PC</b>

## 5.7 Interfaces for automation



**Damage to the machine due to improper connection!**

**Unsuitable control leads or incorrect connection of input and output signals can cause damage to the machine.**

- **Only use shielded control leads!**
- **If the machine is to be operated with control voltages connection via suitable isolation amplifiers is required!**
- **To control the main or secondary current via control voltages, the relevant inputs must be enabled (see specification for activation of control voltage).**

## 5.7.1 Remote control connection socket, 19-pole

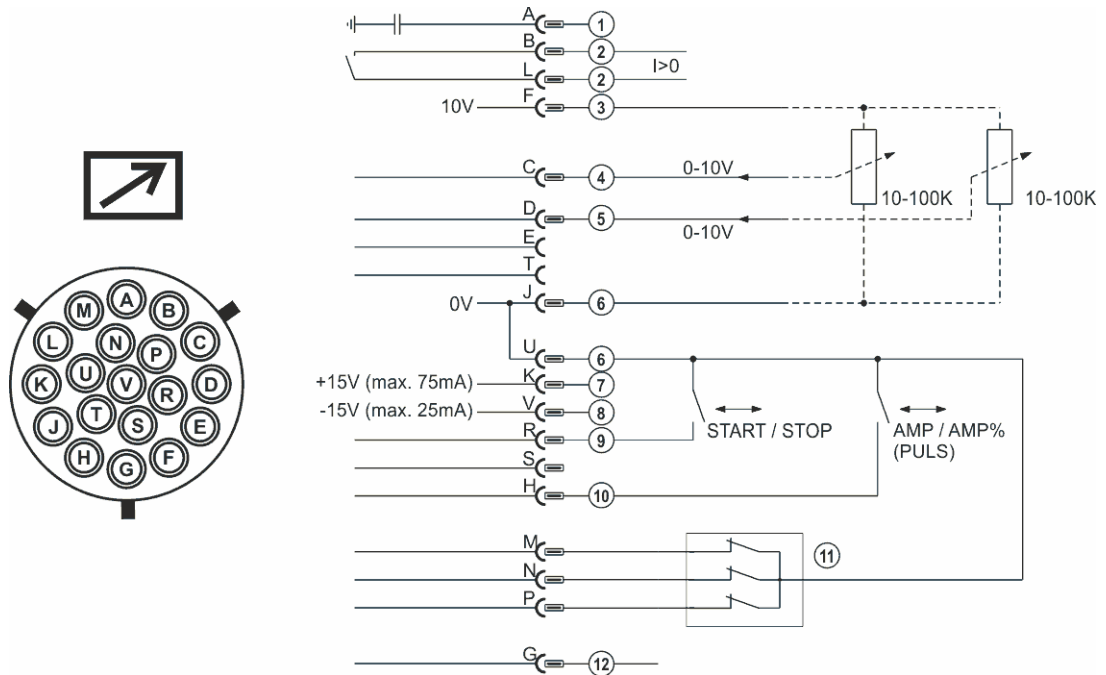


Figure 5-15

Pos.	Pin	Signal shape	Designation
1	A	Output	Connection for cable screen (PE)
2	B/L	Output	Current flows signal I>0, galvanically isolated (max. +- 15V/100mA)
3	F	Output	Reference voltage for potentiometer 10V (max. 10mA)
4	C	Input	Control value specification for main current, 0-10V (0V = I <sub>min</sub> , 10V = I <sub>max</sub> )
5	D	Input	Control value specification for secondary current, 0-10V (0V = I <sub>min</sub> , 10V = I <sub>max</sub> )
6	J/U	Output	Reference 0V
7	K	Output	Power supply +15V, max. 75mA
8	V	Output	Power supply -15V, max. 25mA
9	R	Input	Start/Stop welding current
10	H	Input	Switching between main and secondary welding currents (pulses)
11	M/N/P	Input	Activation of control voltage specification Set all 3 signals to reference potential 0V to activate external control voltage specification for main and secondary currents
12	G	Output	Measured value I <sub>SETPOINT</sub> (1V = 100A)

## 6 Maintenance, care and disposal

### 6.1 General

#### **DANGER**



**Risk of injury due to electrical voltage after switching off!**

**Working on an open machine can lead to fatal injuries!**

**Capacitors are loaded with electrical voltage during operation. Voltage remains present for up to four minutes after the mains plug is removed.**

1. Switch off machine.
2. Remove the mains plug.
3. Wait for at least 4 minutes until the capacitors have discharged!

#### **WARNING**



**Incorrect maintenance, testing and repair!**

**Maintenance, testing and repair of the machine may only be carried out by skilled and qualified personnel. A qualified person is one who, because of his or her training, knowledge and experience, is able to recognise the dangers that can occur while testing welding power sources as well as possible subsequent damage, and who is able to implement the required safety procedures.**

Observe the maintenance instructions > see 6.2 chapter.

- In the event that the provisions of one of the below-stated tests are not met, the machine must not be operated again until it has been repaired and a new test has been carried out!

Repair and maintenance work may only be performed by qualified authorised personnel; otherwise the right to claim under warranty is void. In all service matters, always consult the dealer who supplied the machine. Return deliveries of defective equipment subject to warranty may only be made through your dealer. When replacing parts, use only original spare parts. When ordering spare parts, please quote the machine type, serial number and item number of the machine, as well as the type designation and item number of the spare part.

Under the specified ambient conditions and normal working conditions this machine is essentially maintenance-free and requires just a minimum of care.

Contamination of the machine may impair service life and duty cycle. The cleaning intervals depend on the ambient conditions and the resulting contamination of the machine. The minimum interval is every six months.

#### 6.1.1 Cleaning

- Clean the outer surfaces with a moist cloth (no aggressive cleaning agents).
- Purge the machine venting channel and cooling fins (if present) with oil- and water-free compressed air. Compressed air may overspeed and destroy the machine fans. Never direct the compressed air directly at the machine fans. Mechanically block the fans, if required.
- Check the coolant for contaminants and replace, if necessary.

#### 6.1.2 Dirt filter

When using a dirt filter, the cooling air throughput is reduced and the duty cycle of the machine is reduced as a result. The duty cycle decreases with the increasing contamination of the filter. The dirt filter must be removed at regular intervals and cleaned by blowing out with compressed air (depending on the level of soiling).

## 6.2 Maintenance work, intervals

### 6.2.1 Daily maintenance tasks

Visual inspection

- Mains supply lead and its strain relief
- Gas cylinder securing elements
- Check hose package and power connections for exterior damage and replace or have repaired by specialist staff as necessary!
- Gas tubes and their switching equipment (solenoid valve)
- Check that all connections and wearing parts are hand-tight and tighten if necessary.
- Check correct mounting of the wire spool.
- Wheels and their securing elements
- Transport elements (strap, lifting lugs, handle)
- Other, general condition

Functional test

- Operating, message, safety and adjustment devices (Functional test)
- Welding current cables (check that they are fitted correctly and secured)
- Gas tubes and their switching equipment (solenoid valve)
- Gas cylinder securing elements
- Check correct mounting of the wire spool.
- Check that all screw and plug connections and replaceable parts are secured correctly, tighten if necessary.
- Remove any spatter.
- Clean the wire feed rollers on a regular basis (depending on the degree of soiling).

### 6.2.2 Monthly maintenance tasks

Visual inspection

- Casing damage (front, rear and side walls)
- Wheels and their securing elements
- Transport elements (strap, lifting lugs, handle)
- Check coolant tubes and their connections for impurities

Functional test

- Selector switches, command devices, emergency stop devices, voltage reducing devices, message and control lamps
- Check wire guide elements (wire feed roll holder, wire feed nipple, wire guide tube) for tight fit. Recommendation for replacing the wire feed roll holder (eFeed) after 2000 hours of operation, see replacement parts).
- Check coolant tubes and their connections for impurities
- Check and clean the welding torch. Deposits in the torch can cause short circuits and have a negative impact on the welding result, ultimately causing damage to the torch.

### 6.2.3 Annual test (inspection and testing during operation)

A periodic test according to IEC 60974-4 "Periodic inspection and test" has to be carried out. In addition to the regulations on testing given here, the relevant local laws and regulations must also be observed.

For more information refer to the "Warranty registration" brochure supplied and our information regarding warranty, maintenance and testing at [www.ewm-group.com](http://www.ewm-group.com)!

## 6.3 Disposing of equipment



### Proper disposal!

The machine contains valuable raw materials, which should be recycled, and electronic components, which must be disposed of.

- Do not dispose of in household waste!
- Observe the local regulations regarding disposal!
- According to European provisions (Directive 2012/19/EU on Waste of Electrical and Electronic Equipment), used electric and electronic equipment may no longer be placed in unsorted municipal waste. It must be collected separately. The symbol depicting a waste container on wheels indicates that the equipment must be collected separately.  
This machine has to be disposed of, or recycled, in accordance with the waste separation systems in use.
- According to German law (law governing the distribution, taking back and environmentally correct disposal of electric and electronic equipment (ElektroG)), used machines are to be placed in a collection system separate from unsorted municipal waste. The public waste management utilities (communities) have created collection points at which used equipment from private households can be disposed of free of charge.
- Information about returning used equipment or about collections can be obtained from the respective municipal administration office.
- In addition to this, returns are also possible throughout Europe via EWM sales partners.



## 7 Rectifying faults

All products are subject to rigorous production checks and final checks. If, despite this, something fails to work at any time, please check the product using the following flowchart. If none of the fault rectification procedures described leads to the correct functioning of the product, please inform your authorised dealer.

### 7.1 Checklist for rectifying faults

**The correct machine equipment for the material and process gas in use is a fundamental requirement for perfect operation!**

Legend	Symbol	Description
	↗	Fault/Cause
	✘	Remedy

#### Mains fuse triggers

- ↗ Mains fuse triggers - unsuitable mains fuse
  - ✘ Set up recommended mains fuse > see 8 chapter.

#### Functional errors

- ↗ Insufficient coolant flow
  - ✘ Check coolant level and refill if necessary
  - ✘ Eliminate kinks in conduit system (hose packages)
  - ✘ Reset automatic cutout of the coolant pump by activating
- ↗ Air in the coolant circuit
  - ✘ Vent coolant circuit
- ↗ Several parameters cannot be set (machines with access block)
  - ✘ Entry level is blocked, disable access lock
- ↗ All machine control signal lights are illuminated after switching on
- ↗ No machine control signal light is illuminated after switching on
- ↗ No welding power
  - ✘ Phase failure > check mains connection (fuses)
- ↗ Connection problems
  - ✘ Make control lead connections and check that they are fitted correctly.

#### Welding torch overheated

- ↗ Loose welding current connections
  - ✘ Tighten power connections on the torch and/or on the workpiece
  - ✘ Tighten contact tip correctly
- ↗ Overload
  - ✘ Check and correct welding current setting
  - ✘ Use a more powerful welding torch

#### No arc ignition

- ↗ Incorrect ignition type setting.
  - ✘ Ignition type: Select "HF start". Depending on the machine, the setting is defined by the change-over switch for ignition types or the  $hF$  parameter in one of the machine menus (see the "Control operating instructions", if applicable).

#### Bad arc ignition

- ↗ Material inclusions in the tungsten electrode due to contact with filler material or workpiece
  - ✘ Regrind or replace the tungsten electrode
- ↗ Bad current transfer on ignition
  - ✘ Check the setting on the "Tungsten electrode diameter/ignition optimisation" rotary dial and increase if necessary (higher ignition energy).

### Unstable arc

- ✓ Material inclusions in the tungsten electrode due to contact with filler material or workpiece
  - ✗ Regrind or replace the tungsten electrode
- ✓ Incompatible parameter settings
  - ✗ Check settings and correct if necessary

### Pore formation

- ✓ Inadequate or missing gas shielding
  - ✗ Check shielding gas setting and replace shielding gas cylinder if necessary
  - ✗ Shield welding site with protective screens (draughts affect the welding result)
  - ✗ Use gas lens for aluminium applications and high-alloy steels
- ✓ Unsuitable or worn welding torch equipment
  - ✗ Check size of gas nozzle and replace if necessary
- ✓ Condensation (hydrogen) in the gas tube
  - ✗ Purge hose package with gas or replace

## 7.2 Vent coolant circuit

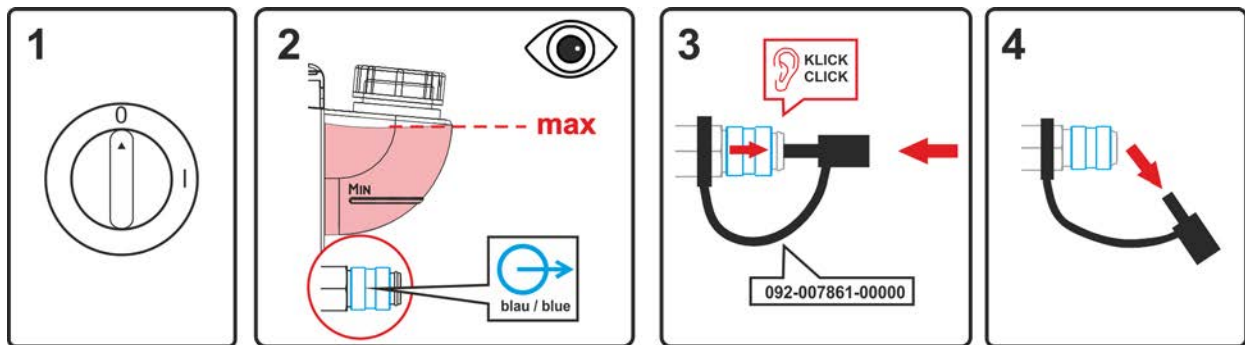


Figure 7-1

- Switch off the machine and fill the coolant tank to the maximum level.
- Unlock the quick-connect coupling with a suitable tool (connection open).

**To vent the cooling system always use the blue coolant connection, which is located as deep as possible inside the system (close to the coolant tank)!**

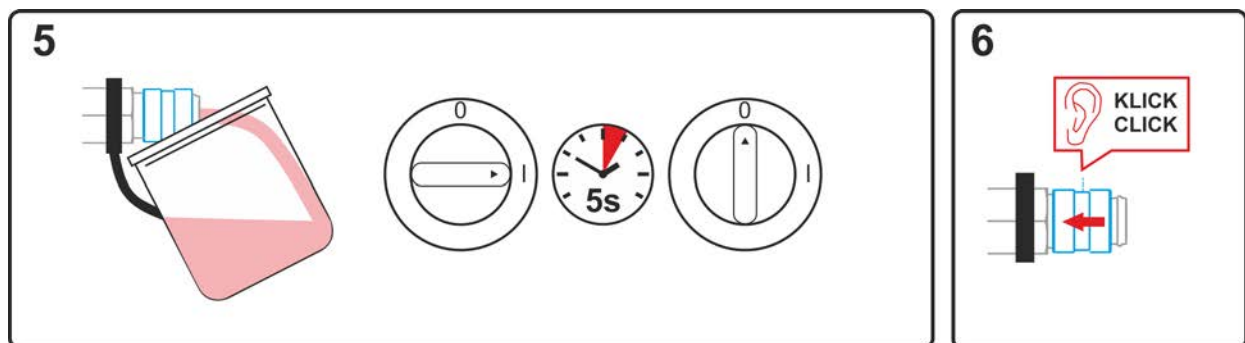


Figure 7-2

- Position a suitable collection container for collecting the escaping coolant at the quick-connect coupling and switch on the machine for approx. 5s.
- Lock the quick-connect coupling by pushing back the locking ring.

## 8 Technical data

Performance specifications and guarantee only in connection with original spare and replacement parts!

### 8.1 Tetrix 300

	TIG	MMA
Welding current (I <sub>2</sub> )	5 A to 300 A	
Welding voltage according to standard (U <sub>2</sub> )	10,2 V to 22,0 V	20,2 V to 32 V
Duty cycle DC at 40° C <sup>[1]</sup>		
30 %	-	300 A
35 %	300 A	-
60 %	260 A	
100 %	210 A	
Open circuit voltage (U <sub>0</sub> )	63 to 95 V	63 V
Mains voltage (Tolerance)	3 x 400 V (-25% to +20 %)	
Frequency	50/60 Hz	
mains fuse <sup>[2]</sup>	3 x 16 A	
Mains connection cable	H07RN-F4G2,5	
max. Connected load (S <sub>1</sub> )	11,4 kVA	16,6 kVA
Generator rating (Rec.)	22,4 kVA	
Cos φ / efficiency	0,99	88 %
Protection class / Overvoltage category	I / III	
Contamination level	3	
Insulation class / protection classification	H / IP 23	
Residual current circuit breaker	Type B (recommended)	
Noise level <sup>[3]</sup>	<70 dB(A)	
Ambient temperature <sup>[4]</sup>	-25 °C to +40 °C	
Machine cooling / Torch cooling	Fan (AF) / gas or water	
Workpiece lead (min.)	35 mm <sup>2</sup>	
EMC class	A	
Safety marking	☐ / CE / EAC	
Standards used	See declaration of conformity (appliance documents)	
Dimensions (l x b x h)	539 x 210 x 415 mm	
	21.2 x 8.3 x 16.3 inch	
Weight	20,5 kg	
	45.2 lb.	

<sup>[1]</sup> Load cycle: 10 min. (60 % DC  $\triangleq$  6 min. welding, 4 min. pause)

<sup>[2]</sup> Safety fuses are recommended DIAZED xxA gG. When using automatic cutouts, the "C" trigger characteristic must be used.

<sup>[3]</sup> Noise level during idle mode and operation under standard load according to IEC 60974- 1 at the maximum operating point.

<sup>[4]</sup> Ambient temperature dependent on coolant! Observe coolant temperature range!

## 8.2 Tetrix 300 AC/DC

	TIG	MMA
Welding current (I <sub>2</sub> )	5 A to 300 A	
Welding voltage according to standard (U <sub>2</sub> )	10,2 V to 22,0 V	20,2 V to 32 V
Duty cycle DC at 40° C <sup>[1]</sup>		
30 %	-	300 A
35 %	300 A	-
60 %	260 A	
100 %	210 A	
Open circuit voltage (U <sub>0</sub> )	63 V	
Mains voltage (Tolerance)	3 x 400 V (-25% to +20 %)	
Frequency	50/60 Hz	
mains fuse <sup>[2]</sup>	3 x 16 A	
Mains connection cable	H07RN-F4G2,5	
max. Connected load (S <sub>1</sub> )	11,7 kVA	17 kVA
Generator rating (Rec.)	23 kVA	
Cos φ / efficiency	0,99	88 %
Protection class / Overvoltage category	I / III	
Contamination level	3	
Insulation class / protection classification	H / IP 23	
Residual current circuit breaker	Type B (recommended)	
Noise level <sup>[3]</sup>	<70 dB(A)	
Ambient temperature <sup>[4]</sup>	-25 °C to +40 °C	
Machine cooling / Torch cooling	Fan (AF) / gas or water	
Workpiece lead (min.)	35 mm <sup>2</sup>	
EMC class	A	
Safety marking	[S] / CE / EAC	
Standards used	See declaration of conformity (appliance documents)	
Dimensions (l x b x h)	539 x 210 x 415 mm	
	21.2 x 8.3 x 16.3 inch	
Weight	22,6 kg	
	49.8 lb.	

<sup>[1]</sup> Load cycle: 10 min. (60 % DC  $\triangleq$  6 min. welding, 4 min. pause)

<sup>[2]</sup> Safety fuses are recommended DIAZED xxA gG. When using automatic cutouts, the "C" trigger characteristic must be used.

<sup>[3]</sup> Noise level during idle mode and operation under standard load according to IEC 60974- 1 at the maximum operating point.

<sup>[4]</sup> Ambient temperature dependent on coolant! Observe coolant temperature range!

## 9 Accessories

Performance-dependent accessories like torches, workpiece leads, electrode holders or intermediate hose packages are available from your authorised dealer.

### 9.1 Welding torch cooling system

Type	Designation	Item no.
cool41 U31	Cooling module	090-008600-00502
HOSE BRIDGE UNI	Tube bridge	092-007843-00000

#### 9.1.1 Coolant - type blueCool

Type	Designation	Item no.
blueCool -10 5 l	Coolant up to -10 °C (14 °F), 5 l	094-024141-00005
blueCool -10 25 l	Coolant up to -10 °C (14 °F), 25 l	094-024141-00025
blueCool -30 5 l	Coolant up to -30 °C (22 °F), 5 l	094-024142-00005
blueCool -30 25 l	Coolant up to -30 °C (22 °F), 25 l	094-024142-00025
FSP blueCool	Frost protection tester	094-026477-00000

#### 9.1.2 Coolant - type KF

Type	Designation	Item no.
KF 23E-5	Coolant up to -10 °C (14 °F), 5 l	094-000530-00005
KF 23E-200	Coolant (-10 °C), 200 litres	094-000530-00001
KF 37E-5	Coolant up to -20 °C (4 °F), 5 l	094-006256-00005
KF 37E-200	Coolant (-20 °C), 200 l	094-006256-00001
TYP1	Frost protection tester	094-014499-00000

### 9.2 Transport system

Type	Designation	Item no.
Trolley 55-6	Transport cart, assembled	090-008825-00000
Trolley 55-5	Transport cart, assembled	090-008632-00000
Trolley 35.2-2	Transport vehicle	090-008296-00000
Trolley 38-2 E	Transport vehicle, long wheelbase	090-008270-00000

## 9.3 Remote controls and accessories

### 9.3.1 7-pole connection

Type	Designation	Item no.
RT50 7POL	Remote control, full functionality	090-008793-00000
FRV 7POL 0.5 m	Extension/connecting cable	092-000201-00004
FRV 7POL 1 m	Extension/connecting cable	092-000201-00002
FRV 7POL 5 m	Extension/connecting cable	092-000201-00003
FRV 7POL 10 m	Extension/connecting cable	092-000201-00000
FRV 7POL 20 m	Extension/connecting cable	092-000201-00001
FRV 7POL 25M	Extension/connecting cable	092-000201-00007

### 9.3.2 19-pole connection

Type	Designation	Item no.
RTF1 19POL 5 M	Foot-operated remote control current with connection cable	094-006680-00000
RT1 19POL	Remote control current	090-008097-00000
RTG1 19POL 5m	Remote control, current	090-008106-00000
RTAC1 19POL	Remote control for current/balance/frequency Suitable for machines with AC welding type only.	090-008197-00000
RT PWS1 19POL	Remote control, vertical-down weld current, pole reversal	090-008199-00000
RTP1 19POL	Remote control spot welding / pulses	090-008098-00000
RTP2 19POL	Remote control spot welding / pulses	090-008099-00000
RTP3 spotArc 19POL	spotArc remote control for spot welding / pulses	090-008211-00000
RA5 19POL 5M	Remote control e.g. connection cable	092-001470-00005
RA10 19POL 10m	Remote control e.g. connection cable	092-001470-00010
RA20 19POL 20m	Remote control e.g. connection cable	092-001470-00020
RV5M19 19POLE 5M	Extension cable	092-000857-00000

## 9.4 Options

Type	Designation	Item no.
ON TR Trolley 55-5	Cross arm and holder for wire feeder	092-002700-00000
ON Filter TG.0002	Retrofit option, dirt filter for air inlet	092-002551-00000
ON PC PLUG	Protective cap for plug	092-003074-00000
ON 12pol Retox TG.0002	Optional retrofit 12-pole connection socket, torch	092-002519-00000

## 9.5 General accessories

Type	Designation	Item no.
KLF-L1-L2-L3-PE	Label of mains cable	094-023697-00000
GH 2X1/4" 2M	Gas hose	094-000010-00001
DM 842 Ar/CO2 230bar 30l D	Pressure regulator with manometer	394-002910-00030
16A 5POLE/CEE	Mains plug	094-000712-00000

## 9.6 Computer communication

Type	Designation	Item no.
PC300 XQ Set	PC300.Net welding parameter software kit incl. cable and SECINT X10 USB interface	090-008777-00000

## 10 Appendix

### 10.1 Searching for a dealer

Sales & service partners  
[www.ewm-group.com/en/specialist-dealers](http://www.ewm-group.com/en/specialist-dealers)



"More than 400 EWM sales partners worldwide"